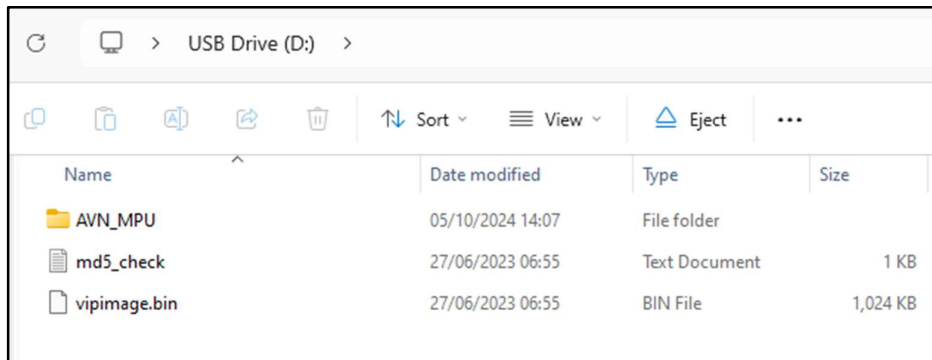**MG4 – Trophy – Infotainment update instructions.**

Section 1 – USB Preparation

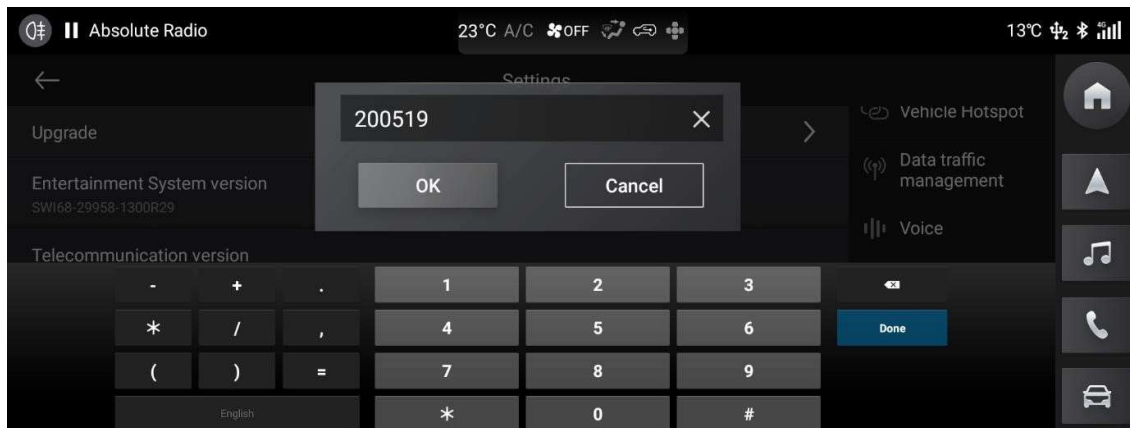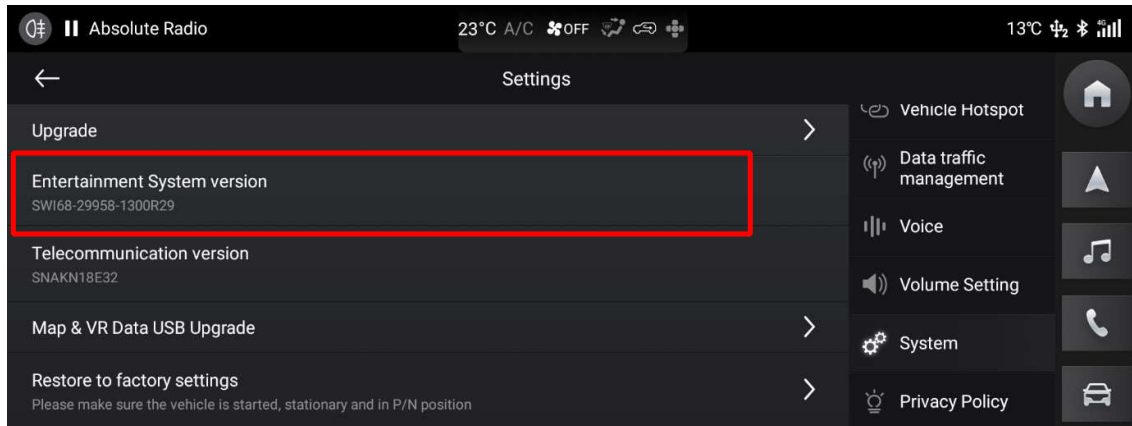1. Unzip the R63 update software.

⊘ R63

2. Copy the contents of the unzipped folder to the root of a USB memory stick with a minimum capacity of 2GB. The files on the USB should look like the following picture.
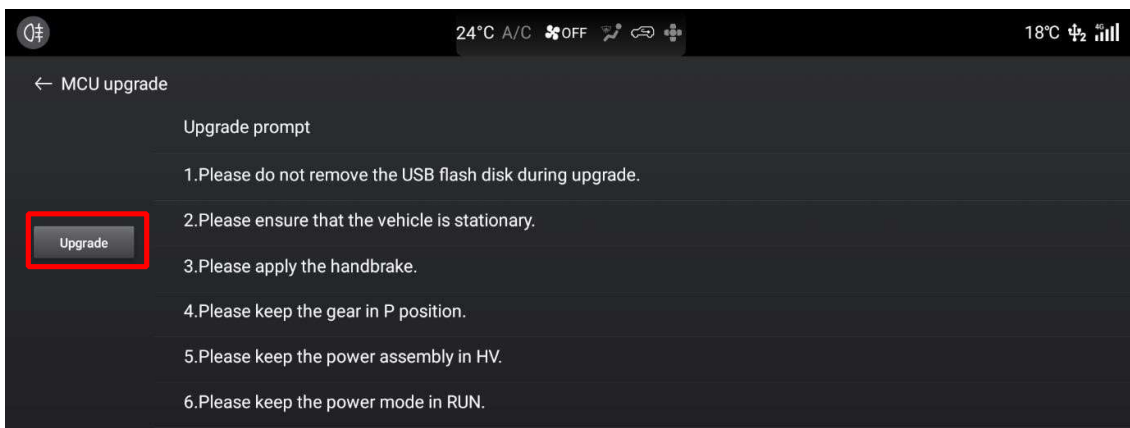
Section 2 – Infotainment System ECU Update

1. Put the vehicle into READY mode with the handbrake applied and the shifter in the 'P' position

2. Insert the prepared USB memory stick into the vehicle USB socket

3. Go to 'Settings' and then select 'System' from the tabs displayed on the RH side of the screen. Tap 'Entertainment System Version' 5 times. A dialog box will appear. Type in the number 200519 and then press OK
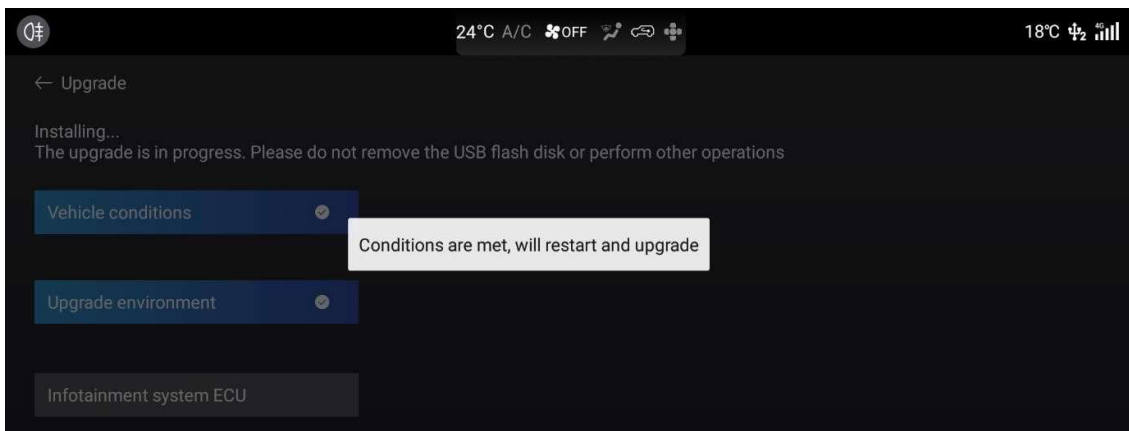
4. In the engineering menu that appears select 'USB upgrade' then 'Infotainment system ECU'
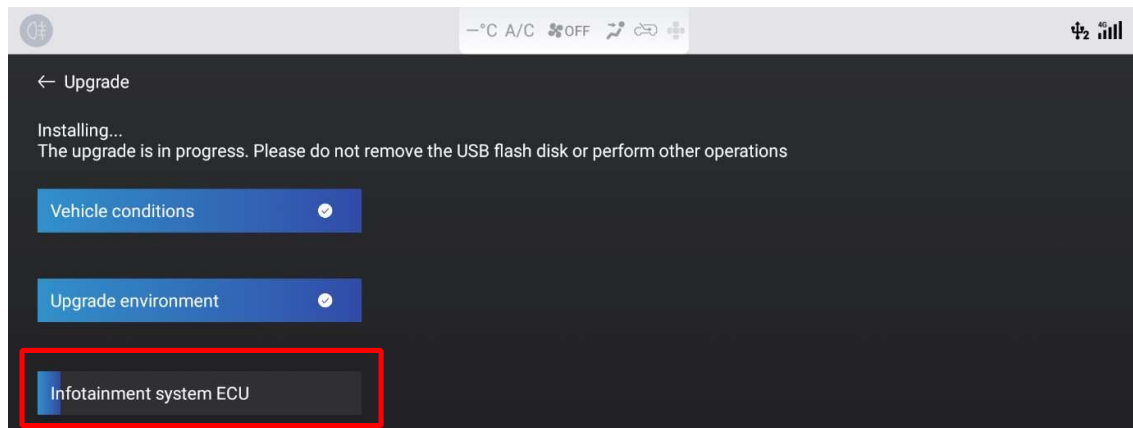

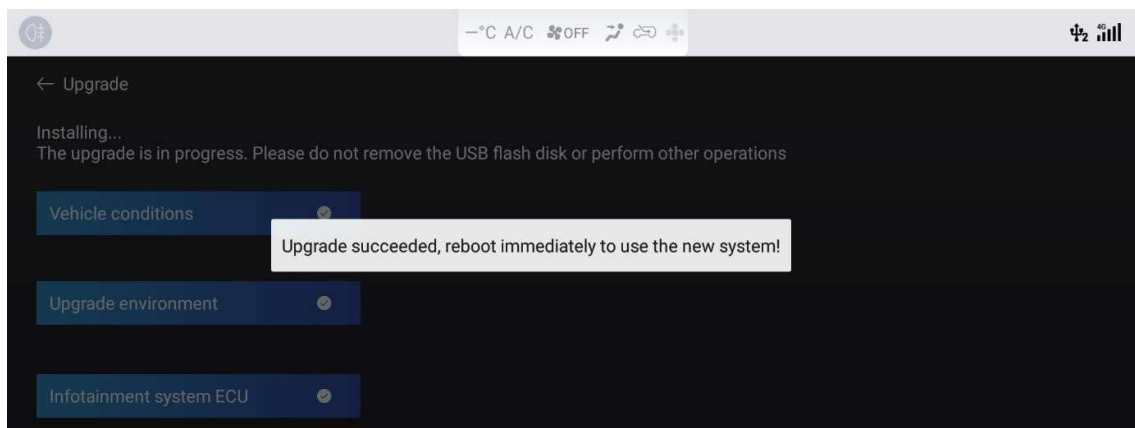6. Read the instructions shown and then press 'Upgrade'

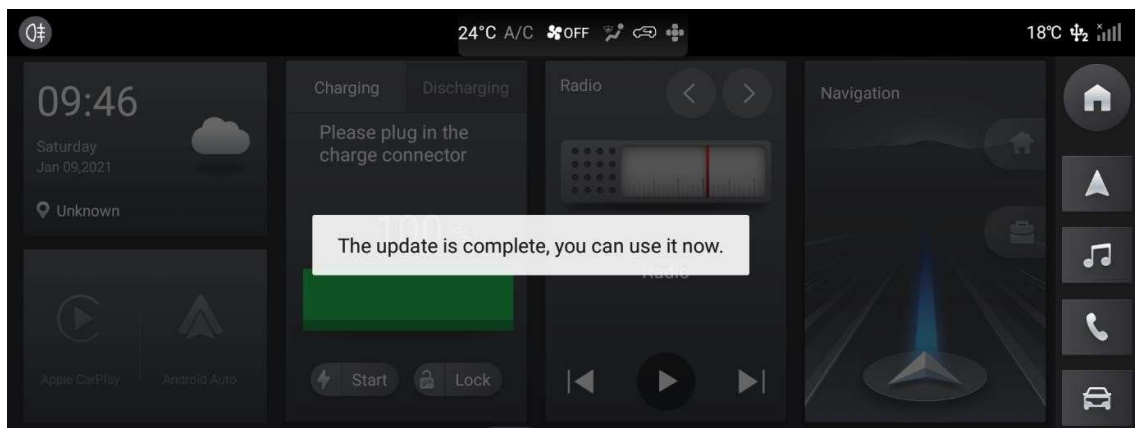7.If the update conditions are correct the system will restart and then proceed with the update.

8.During the update the following screen is shown. The bottom bar shows the update progress.

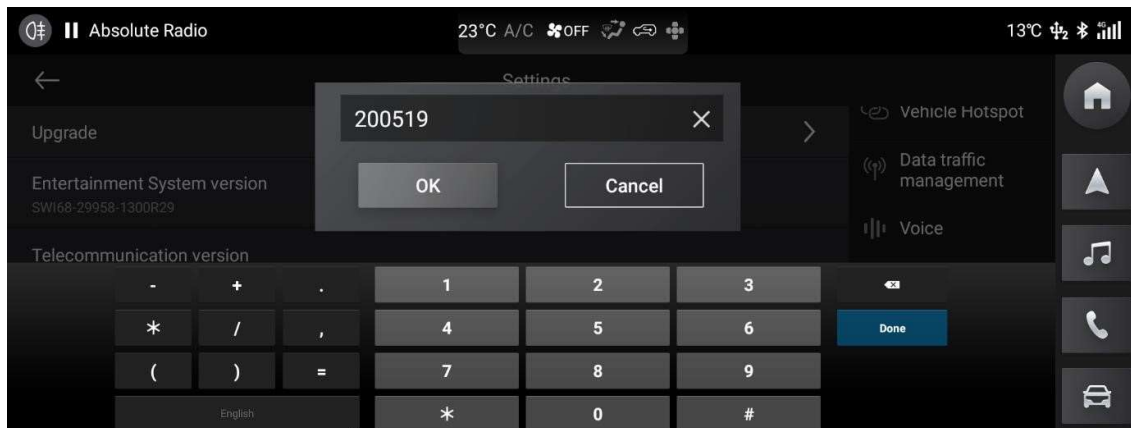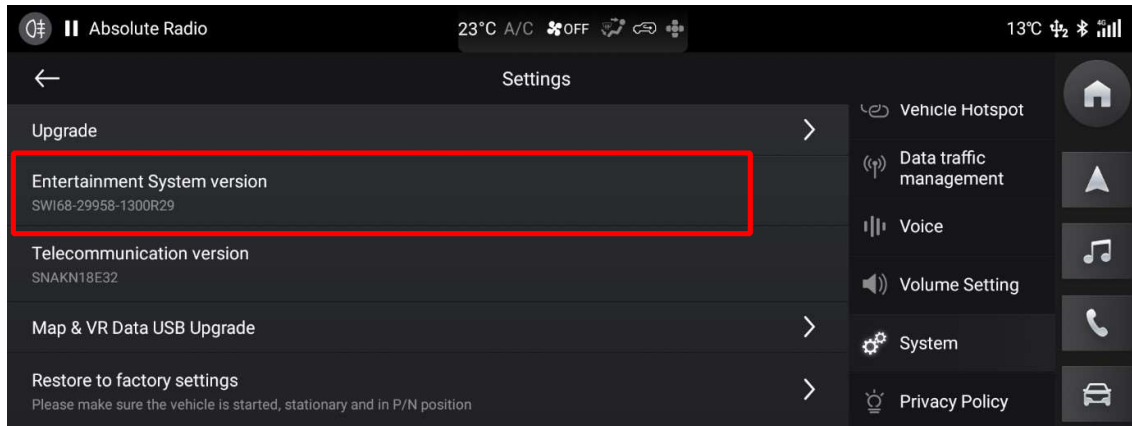9.Once the update is complete the following screen is shown. The system will reboot automatically.

10.Once the reboot is complete a message will indicate that the update has been successful.
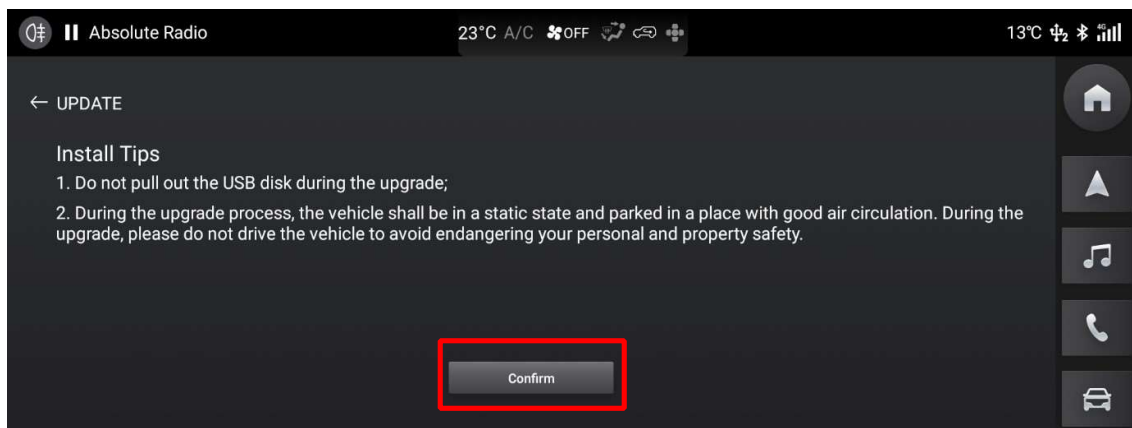
Section 3 – AVN MPU Update

1. Put the vehicle into READY mode with the handbrake applied and the shifter in the 'P' position

2. Insert the prepared USB memory stick into the vehicle USB socket

3. Go to 'Settings' and then select 'System' from the tabs displayed on the RH side of the screen. Tap 'Entertainment System Version' 5 times. A dialog box will appear. Type in the number 200519 and then press OK
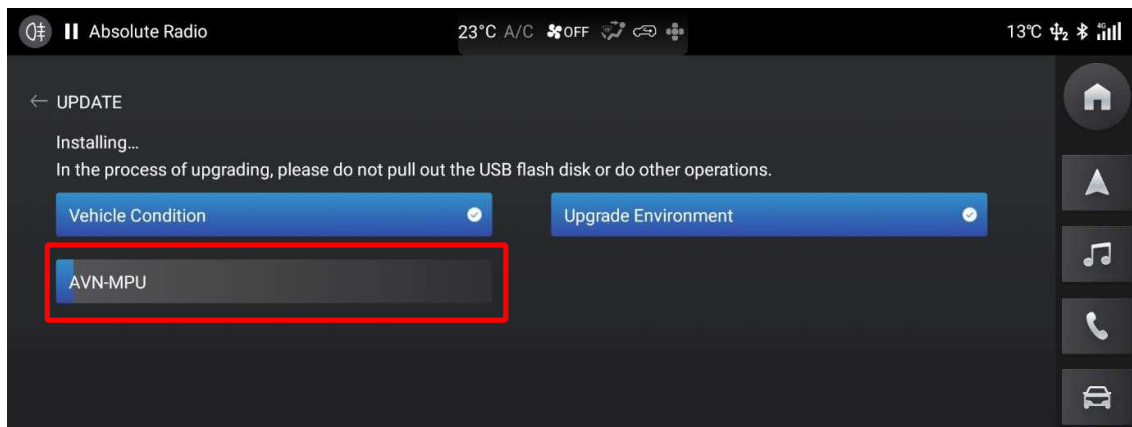
4. In the engineering menu that appears select 'USB upgrade' then 'AVN MPU'
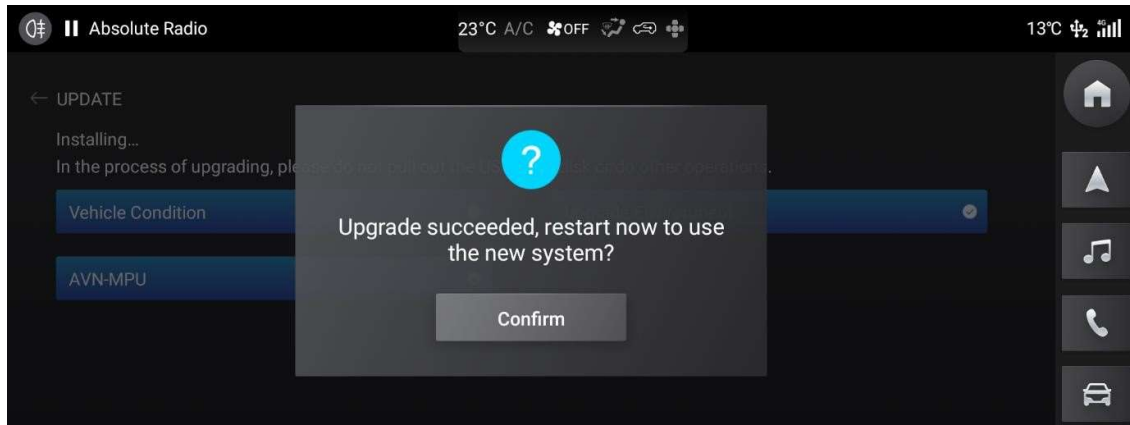

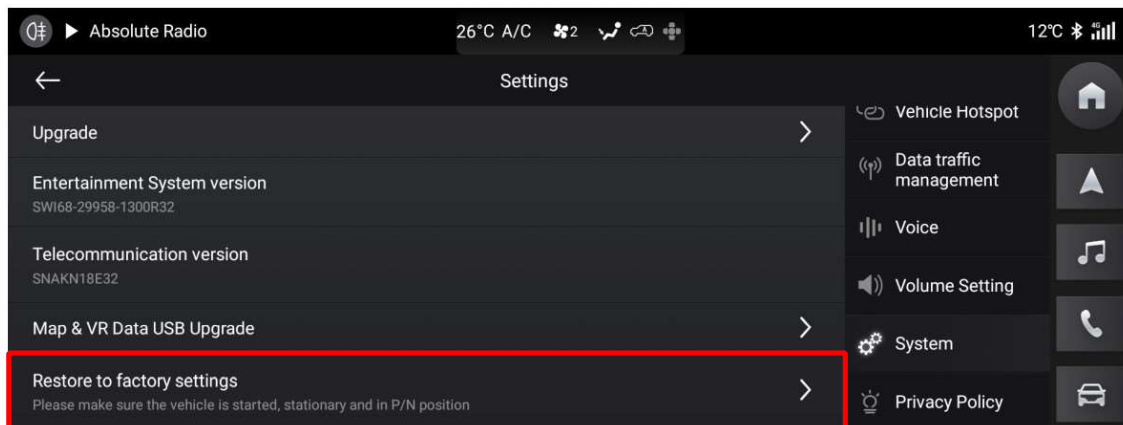5. Read the instructions shown and then press 'Confirm'

6. If the update conditions are correct the system will proceed with the update. During the update the following screen is shown. The bottom bar shows the update progress.

7. Once the update is complete the following screen is shown. Press 'Confirm' to restart the system.

8. Once the reboot is complete go to Settings > System and Restore the unit to factory settings.

Once the USB software has been applied and the Factory reset carried out, it is important to update the software Via SIPS. For the R63 update, the software for the FICM (config and Calibration) and the HVAC (config and calibration) software must show ticks in SIPS.